

S.T.D. METERING AT P.M.B.X.'S
 SWITCHBOARD P.M.B.X. No. 2/4 A SCHEMES A B & DI (NOTE 1)

NI008
 PAGE 1-2
 ISSUE A

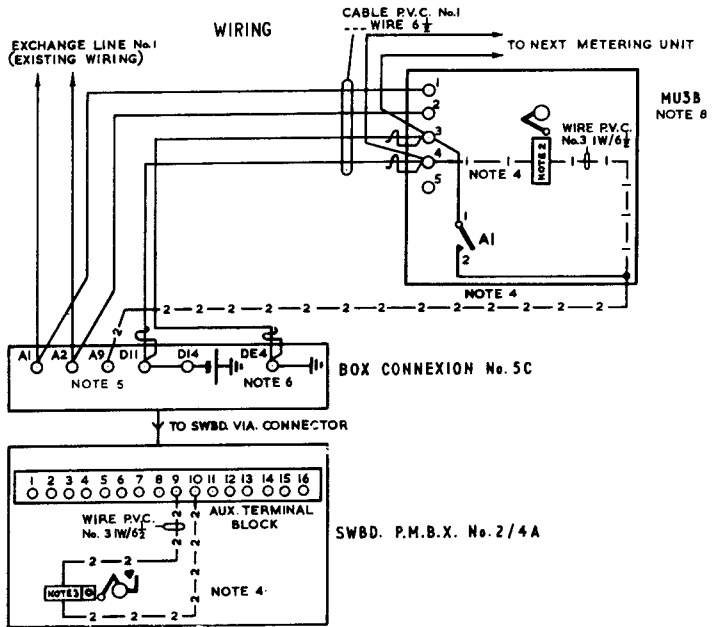


TABLE 1. MU & TRIP METER CONNEXIONS				
Exch. Line No.:-	Tags 1 & 2 of MU3B wired to Box Connexion No. 5C tag No.:-	SCHEMES B & DI ONLY		
		Make contact of MU Relay wired to BC No. 5C tag No.:-	METER NO 21B (TRIP METER)	
			'a' tag wired to Aux Termnl. Block tag No.:-	'b' tag wired to Aux. Termnl. Block tag No.:-
1	A1 & A2	A9	9	10
2	A3 & A4	A10	11	12
3	A5 & A6	A11	13	14
4	A7 & A8	A12	15	16

Post Office Telecomms. Headquarters D1.5.2. Upper W regulation GENERAL	ISSUES			
		A	New Format	8. 7. 68
	E.C.C. Stevens	2-12-63		

APPARATUS SCHEDULE			
RATE BOOK TITLE	SCHEME A	SCHEME B	SCHEME D1
Metering Unit No. 3B (note 8)	1 per E/L to be metered	1 per E/L to be metered	1 per E/L to be metered
Meters No. 21B Grey	nil	1 per MU No. 3B	1 per MU No. 3B
Meters No. 150C	1 per MU No. 3B	nil	1 per MU No. 3B
Meter, Dummy No. 5	nil	see note 7	see note 7
Meter, Dummy No. 6	nil	see note 7	see note 7
Meter, Dummy No. 7	nil	see note 7	see note 7
Mounting D91477	1 per Metering Unit No. 3B	1 per Metering Unit No. 3B	1 per Metering Unit No. 3B
Strip Designation No. 34A Complete	nil	one	one
Part 1/DBL/95	as required	as required	as required
Strip Designation No. 35A Complete	nil	one	one

NOTES

1. See dgm. N1010 for details of metering schemes.
2. Meter No. 150C fitted in mounting position provided in MU3B.
3. The Meters No. 21B are fitted in the face panel of the switchboard immediately below the appropriate exchange line lamp. The Strip, Designation No. 41A should be removed. A Strip, Designation No. 34A Complete should be mounted above the first "free link" lamp using the screws provided. A Strip, Designation No. 35A should be fitted using the upper fixing screws of the Meters or Meter Dummy's.
4. For scheme A provide additional wiring shown thus -1-1--
 For scheme B provide additional wiring shown thus -2-2--
 For scheme D1 provide additional wiring shown thus -1-1 and -2-2--
5. Tag connexions for first Exchange Line only. For other Exchange Lines see table 1.
6. A strap should be provided between tags D11 and D14.
7. A Meter, Dummy No. 5 should be fitted in lieu of one Meter No. 21B, Grey.
 A Meter, Dummy No. 6 should be fitted in lieu of two Meters No. 21B, Grey.
 A Meter, Dummy No. 7 should be fitted in lieu of three Meters No. 21B, Grey.
8. Works Specification S(W)2014 gives details of Metering Units 3B.